

Work Order ID 123289

\*123289\*

Page 1

Wednesday, August 06, 2014 3:44:04 PM

Item ID: D212-664-101

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Fwd Crosstube - High

Start Date: 8/08/14 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 8/15/14 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: [Signature] Date: 11-8-6 Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr	
D212-664-141	E	<u>SP</u>

100	Document Control	0.00							<u>M41</u>
-----	------------------	------	--	--	--	--	--	--	------------

\*100\*

DC	Memo	0.00							<u>1</u> <u>17/09/16</u>
----	------	------	--	--	--	--	--	--	--------------------------

Doc.Control USB or Paperwork Photocopy bluefile and create labels as per PPP D212-664-101 CHG006

110	Pick Kit	0.00							<u>BL</u> <u>14-08-26</u>
-----	----------	------	--	--	--	--	--	--	---------------------------

\*110\*

Packaging	Memo	0.00							
-----------	------	------	--	--	--	--	--	--	--

Packaging

120	BENDING MACHINE - CROSSTUBES	0.00							<u>BL</u> <u>14-08-26</u>
-----	------------------------------	------	--	--	--	--	--	--	---------------------------

\*120\*

CNC Bend 2	Memo	0.00							
------------	------	------	--	--	--	--	--	--	--

CNC Alpha 160 Bender Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Fólio D212-664-101

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td style="width:25%;">           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </td> <td style="width:25%;">           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </td> <td style="width:25%;">           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </td> <td style="width:25%;">           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </td> </tr> </table>	Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>
Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>			

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

**FAULT CATEGORY**

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Work Order ID 123289

**\*123289\***

Page 2

Wednesday, August 06, 2014 3:44:04 PM

Item ID: D212-664-101 Accept **\*N900040100\*** Setup Start **\*NS1\***  
 Revision ID: Stop **\*NS2\***  
 Item Name: Fwd Crosstube - High  
 Start Date: 8/08/14 Start Qty: 1.00 **\*1\*** Cust Item ID:  
 Required Date: 8/15/14 Req'd Qty: 1.00 **\*1\*** Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start **\*NR1\***  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130	QC15- Crosstube Dimensional Check	0.00							
<b>*130*</b>									
QC	Memo	0.00							
Quality Control									
140	Crosstubes	0.00							
<b>*140*</b>									
Crosstubes	Memo	0.00							
Crosstubes	1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549,using drill table DT8577,set-up towers in hole #7 as per QSI 10								
	2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549.Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.								
	3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141								
	4-*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141								

DAS  
03  
8-28

*[Signature]* 14-8-27

*BL/mm* 14-08-27

*BL* 14-08-28

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<table style="width: 100%;"> <tr> <td style="width: 33%;">           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </td> <td style="width: 33%;">           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </td> <td style="width: 33%;">           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </td> <td style="width: 33%;">           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </td> </tr> </table>	Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>
Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>			

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

**FAULT CATEGORY**

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Work Order ID 123289

\*123289\*

Page 3

-Wednesday, August 06, 2014 3:44:04 PM

Item ID: D212-664-101

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Fwd Crosstube - High

Start Date: 8/08/14 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 8/15/14 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
150	QC5- Inspect part completeness to step on W/O	0.00							DAS 38 9-89
*150*									14-8-28
QC	Memo	0.00							
Quality Control	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
160		0.00							DAS 41 9-89
*160*									14-9-2
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	1- CLEAN CROSSTUBE WITH WASH'N WIPE								
170	Outsource process - NDT per QSI038 4.1	0.00							
*170*									Q2 14/09/03①
Outsource2	Memo	0.00							
Outsource process - NDT	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	Liquid Penetrant Inspection as per QSI 038								
	Issue P/O: 25570								
	LPI as per ASTM 1417 Level 2								
	Attach copy of NDT results to work order								

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre.									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

**Work Order ID 123289****\*123289\***

Page 4

Wednesday, August 06, 2014 3:44:04 PM

Item ID: D212-664-101

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Fwd Crosstube - High

Start Date: 8/08/14 Start Qty: 1.00 **\*1\***

Cust Item ID:

Required Date: 8/15/14 Req'd Qty: 1.00 **\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

180

Receive & Inspect for Damage & Mat'l Certs  
Packaging

0.00

**\*180\***

Packaging

Memo

0.00

Packaging

Ensure copy of NDT results attached to work order.

190

QC5- Inspect part completeness to step on W/O

0.00

**\*190\***

QC

Memo

0.00

Quality Control

\*\*\* WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE\*\*\*

Inspect for damage &amp; ensure results are as per Dwg D212-664-141

193

Crosstubes Chemical Conversion

0.00

**\*193\***

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

\*\*\* WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE\*\*\*

1- PRESSURE WASH AND THEN USE WASH'N WIPE TO CLEAN  
CROSSTUBE BEFORE CHEMICAL CONVERSION

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--



• Wednesday, August 06, 2014 3:44:04 PM

**Item ID:** D212-664-101

**Accept**

**\*N900040100\***

Setup Start \*NS1\*

Revision ID:

**Item Name:** Fwd Crosstube - High

Stop **\*NS2\***

**Start Date:** 8/08/14      **Start Qty:** 1.00

**\*1\***

**Cust Item ID:**

**Required Date:** 8/15/14      **Req'd Qty:** 1.00

**\*1\***

**Customer:**

**Reference:**

**Approvals:**      **Process Plan:** \_\_\_\_\_ **Date:** \_\_\_\_\_ **Tooling:** \_\_\_\_\_ **Date:** \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/  
Work Center ID

### Operation Description

### Set Up/ Run Hours

Tool ID	Tool #	Plan Code
---------	--------	-----------

**Accept  
Qty**

Reject  
QtyReject  
Number**Insp.  
Stamp**

195

QC7-Inspect Chemical Conversion Coat

0.00

**\*195\***

QC

## Memo

0.00

### Quality Control

\*\*\* WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE\*\*\*

**DAS**

41

**9-89**

14-9-6

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre.									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
--	--	---	--

# Work Order ID 123289

**\*123289\***

Page 6

Wednesday, August 06, 2014 3:44:04 PM

Item ID: D212-664-101 Accept **\*N900040100\*** Setup Start **\*NS1\***  
 Revision ID: Stop **\*NS2\***  
 Item Name: Fwd Crosstube - High  
 Start Date: 8/08/14 Start Qty: 1.00 **\*1\*** Cust Item ID:  
 Required Date: 8/15/14 Req'd Qty: 1.00 **\*1\*** Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start **\*NR1\***  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200	Spray Painting per QSI005 4.2	0.00							DAS
<b>*200*</b>	SprayPaint					1			41
	Memo	0.00							9-89
	Spray Painting	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***							14-9-6

1-Prime inside and outside crosstube as per QSI 005 4.2

PRIME BATCH: 129807

Start Time: 2:00

Finish Time: 2:45

\*\*\*MASK UNDERSIDE OF CROSSTUBE AS SHOWN ON DWG\*\*\*

2-Paint outside crosstube with White Imron as per QSI 005 4.2

PAINT BATCH: 129977

Start Time: 7:00

Finish Time: 7:45

3- Remove masking and apply matte clear coat as per dwg

CLEAR BATCH: 129174

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
--	--	---	--

# Work Order ID 123289

\*123289\*

Page 7

Wednesday, August 06, 2014 3:44:04 PM

Item ID: D212-664-101 Accept \*N900040100\* Setup Start \*NS1\*  
 Revision ID: Stop \*NS2\*  
 Item Name: Fwd Crosstube - High  
 Start Date: 8/08/14 Start Qty: 1.00 \*1\* Cust Item ID:  
 Required Date: 8/15/14 Req'd Qty: 1.00 \*1\* Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start \*NR1\*  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

210	QC14- Inspect Spray Paint	0.00							
*210*									
QC	Memo	0.00							
Quality Control	Then, Wrap in plastic bag to protect from scratches								

DAS  
02  
9-89  
14-09-09

220	Crosstubes	0.00							
*220*									
Crosstubes	Memo	0.00							
Crosstubes	1- Abrade mating surfaces of support and crosstube with 180 grit sandpaper, clean the area with MEK or equivalent as per dwg								

DAS  
41  
9-89

14-9-11

2- Install supports with Proseal 890 per D212-664-141 and QSI 015  
 A/R Proseal 890 Batch: 128712  
 EXP: 10/14  
 PROSEAL CURE TIME 72 HOURS:  
 Start: 14-9-11  
 Finish: 14-9-14

3- Install clamps with rubber cushion (ENSURE CLAMPS ARE INSTALL ON TOP SIDE OF CROSSTUBE) using DT9565 as per Dwg D212-664-141.

\*\*\*Torque all clamps to 80-100 IN-LBS.\*\*\*

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Work Order ID 123289

\*123289\*

Page 8

Wednesday, August 06, 2014 3:44:04 PM

Item ID: D212-664-101 Accept \*N900040100\* Setup Start \*NS1\*  
 Revision ID: Stop \*NS2\*  
 Item Name: Fwd Crosstube - High  
 Start Date: 8/08/14 Start Qty: 1.00 \*1\* Cust Item ID:  
 Required Date: 8/15/14 Req'd Qty: 1.00 \*1\* Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start \*NR1\*  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230 *230* QC Quality Control	QC5- Inspect part completeness to step on W/O  Memo ***RE-CHECK TORCQUE ON CLAMP AFTER PROSEAL HAS CURED FOR 72HOURS AS PER DWG.***	0.00  0.00				1			DAS 38 9-89 14-9-15
240 *240* Packaging Packaging	Pick Kit  Memo	0.00  0.00				1/4		14-9-15	DAS 26 9-89
250 *250* QC Quality Control	QC4- 100% Inspect kits for completeness  Memo	0.00  0.00				1	2	20 14/09/16.	

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--



# Work Order ID 123289

\*123289\*

Page 9

Wednesday, August 06, 2014 3:44:04 PM

Item ID: D212-664-101 Accept \*N900040100\* Setup Start \*NS1\*  
 Revision ID: Stop \*NS2\*  
 Item Name: Fwd Crosstube - High  
 Start Date: 8/08/14 Start Qty: 1.00 \*1\* Cust Item ID:  
 Required Date: 8/15/14 Req'd Qty: 1.00 \*1\* Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start \*NR1\*  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
260	Packaging	0.00	FG 094						
*260*									
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP D212-664-101								
270	QC21- Final Inspection - Work Order Release	0.00							
*270*									
QC	Memo	0.00							
Quality Control									

DAS  
06  
9-05

SEP 17 2014

14/9/17

14-9-12

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

**FAULT CATEGORY**

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Picklist Print

Wednesday, August 06, 2014 3:44:08 PM

Page 1

Work Order ID: 123289

**\*123289\***

Parent Item: D212-664-101

**\*D212-664-101\***

Parent Item Name: Fwd Crosstube - High

Start Date: 8/08/14

Required Date: 8/15/14

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:E04.02.16ReformatKJ/DS  
 IPP Rev:F 06-03-29 Remove Coments on Pick List JLM  
 IPP Rev:G 07-04-30 As per Rev C JLM IPP Rev:H  
 11.04.26 inspection strip ecn 11-549 EC verf by:DD IPP REV:I 14.05.27  
 AS PER ECN 14-570 DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D212-664-101TRN

Manufactured

No

110

Each

5.0000

1

1

**\*D212-664-101TRN\***

Crosstube Turning Detail

123270

**\*\***

13L 14-08-14

Location

Loc Qty

Loc Code

LG

4

122337

1

122793

1

122794

1

122796

1

LG014

1

119973

1

D3595-063-450

Manufactured

No

230

Each

176.0000

4

4

**\*D3595-063-450\***

Rubber Cushion

**\*\***

DAS  
41  
9-89

14-9-11

Location

Loc Qty

Loc Code

FG

15

88422

5

94274

10

LG050

4

118828

4

LG051

157

109526

2

115083

100

117650

55

4

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
--	--	---	--

# Picklist Print

Wednesday, August 06, 2014 3:44:08 PM

Page 2

Work Order ID: 123289

**\*123289\***

Parent Item: D212-664-101

**\*D212-664-101\***

Parent Item Name: Fwd Crosstube - High

Start Date: 8/08/14

Required Date: 8/15/14

Start Qty: 1.00

Required Qty: 1.00

MS21920-25

Purchased

No

220

Each

45.0000

4

4

DAS

**\*MS21920-25\***

Clamp

**\*\***

**41**  
**9-89**

14-9-11

Location	Loc Qty	Loc Code
FG	2	
120920	2	
LG050	40	
M128012	1	
M128701	1	
M129431	14	
M129592	24	
Return2014	3	
128012	3	

D2893-1

Manufactured

No

220

Each

3.0000

2

2

DAS

**\*D2893-1\***

Support

**\*\***

**41**  
**9-89**

14-9-11

Location	Loc Qty	Loc Code
FG	2	
87289	2	
LG052	1	
119130	1	

D3428-1

Manufactured

No

240

Each

32.0000

1

1

DAS  
06  
9-89

**\*D3428-1\***

Placard

**\*\***

14-9-15

Location	Loc Qty	Loc Code
ST038	32	
107703	1	
119695	7	
120584	12	
123158	12	

DAS  
26  
9-89

Wednesday, August 06, 2014 3:44:08 PM

Shop Packet Print

Page 2

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

**FAULT CATEGORY**

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Picklist Print

Wednesday, August 06, 2014 3:44:08 PM

Page 3

Work Order ID: 123289

\*123289\*

Parent Item: D212-664-101

\*D212-664-101\*

Parent Item Name: Fwd Crosstube - High

Start Date: 8/08/14

Required Date: 8/15/14

Start Qty: 1.00

Required Qty: 1.00

AN6-35A Purchased No 240 Each 44.0000

\*AN6-35A\*

BOLT

\*\*

47 4

m130325

DAS 26 06 9-89

## Location

## Loc Qty

## Loc Code

ST333

44

m128324

2

m129507

42

AN6-36A Purchased No 240 Each 53.0000

\*AN6-36A\*

Bolt

\*\*

4 4

m130325

DAS 26 06 9-89

## Location

## Loc Qty

## Loc Code

ST333

53

M126474

2

m127124

2

M128403

49

MS21042L6 Purchased No 240 Each 461.0000

\*MS21042L6\*

Nut

\*\*

6 6

14-9-15

DAS 26 06 9-89

## Location

## Loc Qty

## Loc Code

ST307

461

m127831

23

m128635

3

m129499

235

m129909

200

DAS 26 06 9-89

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Dwg/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--



# Picklist Print

Wednesday, August 06, 2014 3:44:08 PM

Page 4

Work Order ID: 123289

**\*123289\***

Parent Item: D212-664-101

**\*D212-664-101\***

Parent Item Name: Fwd Crosstube - High

Start Date: 8/08/14

Required Date: 8/15/14

Start Qty: 1.00

Required Qty: 1.00

NAS1149D0663J

Purchased

No

240

Each

1,704.000

187

18

**\*NAS1149D0663J\***

**\*\***

*11-9-15*

Washer



Location

Loc Qty

Loc Code

ST276

1704

123265

4

M126284

3

M126334

699

M127813

35

M127916

12

M128818

351

M129913

600

\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
*18x*

DAS  
28  
9-88

DAS  
06  
9-88

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	--	---


Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

<b>DART AEROSPACE LTD</b>		<b>Work Order:</b>	
<b>Description:</b> Crosstube High Fwd (205/212/412)		<b>Part Number:</b>	<b>D212-664-101</b>
<b>Inspection Dwg:</b> D212-664-141 <b>Rev:</b> E		<b>Page 1 of 1</b>	

Required Dimension	Min	Max
Height	26.79	27.05
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7
Bending Passes	3	--
Crushing	--	7.2%

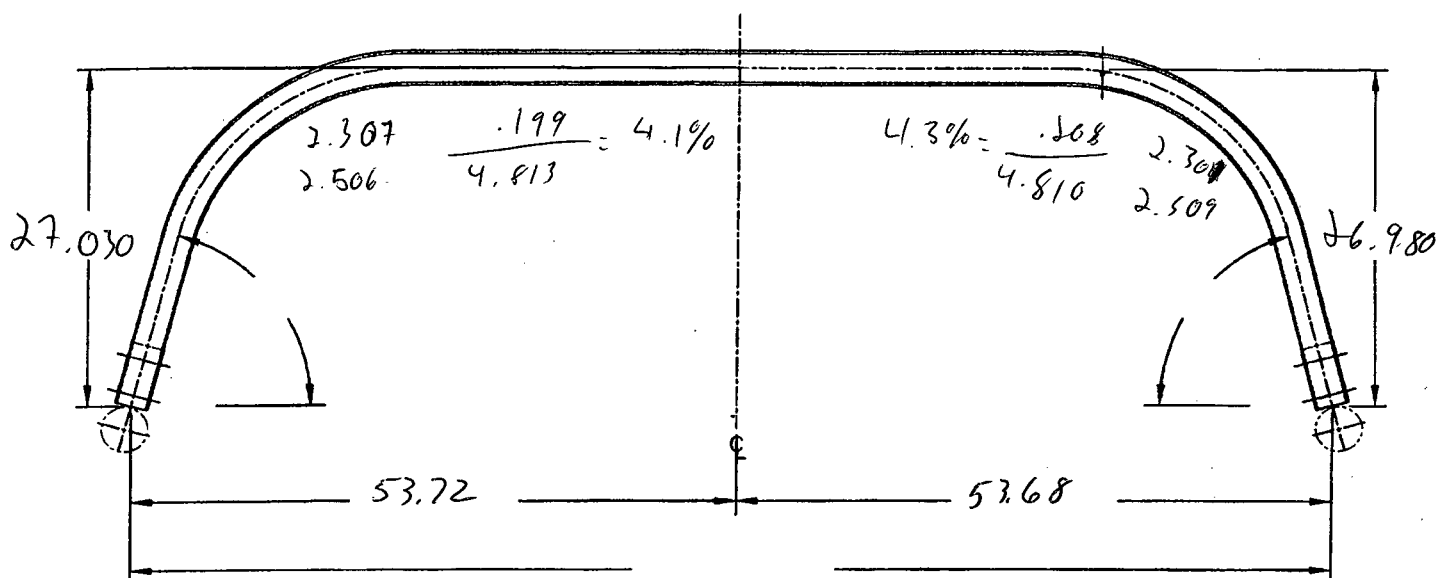

	Side A	Side B
<b>Bending Passes</b>	5	6
<b>Crushing</b>	4.1%	4.3%
<b>Comments</b>		

QC15 Inspection	
Date	14-8-20

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	08.04.21	Dwg Rev updated	KJ/JM	
C	10.04.01	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	
E	14.07.28	Revised max crushing %	KJ	

Item	Qty -141	Qty -141B	Qty -141F	Part Number	Description
1	X			D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X		D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3			X	D212-664-141F	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) (ANODIZED)
4	1	1	1	D6005-128	CROSSTUBE
5	2		2	D2893-1	SUPPORT
6	4	4	4	D3595-063-450	RUBBER CUSHION
7		2		D5017-1	SUPPORT
8	4	4	4	MS21920-25	CLAMP (OR MS21920-26)
9	A/R	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

#### GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6005-128  
FINISHED LENGTH = 126.514±0.020
  - FINISH -141 & -141B: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)  
d) PAINT OUTSIDE PER DART QSI 005 4.2  
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT
  - FINISH -141F: a) ANODIZE PER MIL-A-8625, TYPE II, CLASS 1.  
b) ALODINE (DO NOT ETCH) PER QSI 005 4.1.2  
c) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
d) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)  
e) PAINT OUTSIDE PER DART QSI 005 4.2  
f) REMOVE MASKING AND APPLY MATTE CLEAR COAT
- \*NOTE:** BETWEEN FINISHING OPERATIONS EXTREME CARE MUST BE TAKEN NOT TO CONTAMINATE OR DAMAGE FINISHED SURFACES.
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
  - UNITS: INCHES UNLESS OTHERWISE NOTED.
  - BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
  - IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CLIFF USING VIBRATING STYLUS
  - WEIGHT: D212-664-141/-141B/-141F = 33.8 lbs
  - PART IS SYMMETRIC ABOUT CENTERLINE.
  - EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

#### MACHINING

- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.

#### BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7.2% (BASED ON O.D.) IN LOWER HALF OF R35.5 BEND AND 8% (BASED ON O.D.) ON REMAINING TUBE.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.



#### ASSEMBLY

- TO INSTALL D2893-1 / D5017-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 123289 NW  
14-86

RELEASED  
2014-05-26  
WD

E	ADD -141F. D5017-1 WAS D2893-1 (-141B). PROSEAL WAS MAGNOBOND, NOTE 2: ADD INSPECTION WINDOW, NOTE 11: ALLOW 7.2% CRUSH. NOTE 15: ADD 72HR CURE AND RETORQUE FOR PROSEAL. ADD SHEET 3. CLAMPS REVERSED TO PREVENT CHAFING (B7-2, B7-3). BEND HEIGHT TOL. NOW 0.25 WAS 0.13 (C1-3), INCORP. DEO D-11-2/3	CP	14.04.01
D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	CP	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	DP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	DP		
CHECKED	DW	DRAWING NO.	REV. E
MFG. APPR.	DP	D212-664-141	SHEET 1 OF 5
APPROVED	DP	TITLE	SCALE
DE APPR.	DP	XTUBE ASSY (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

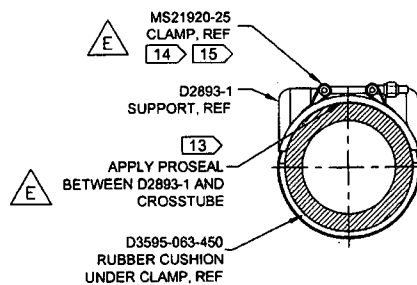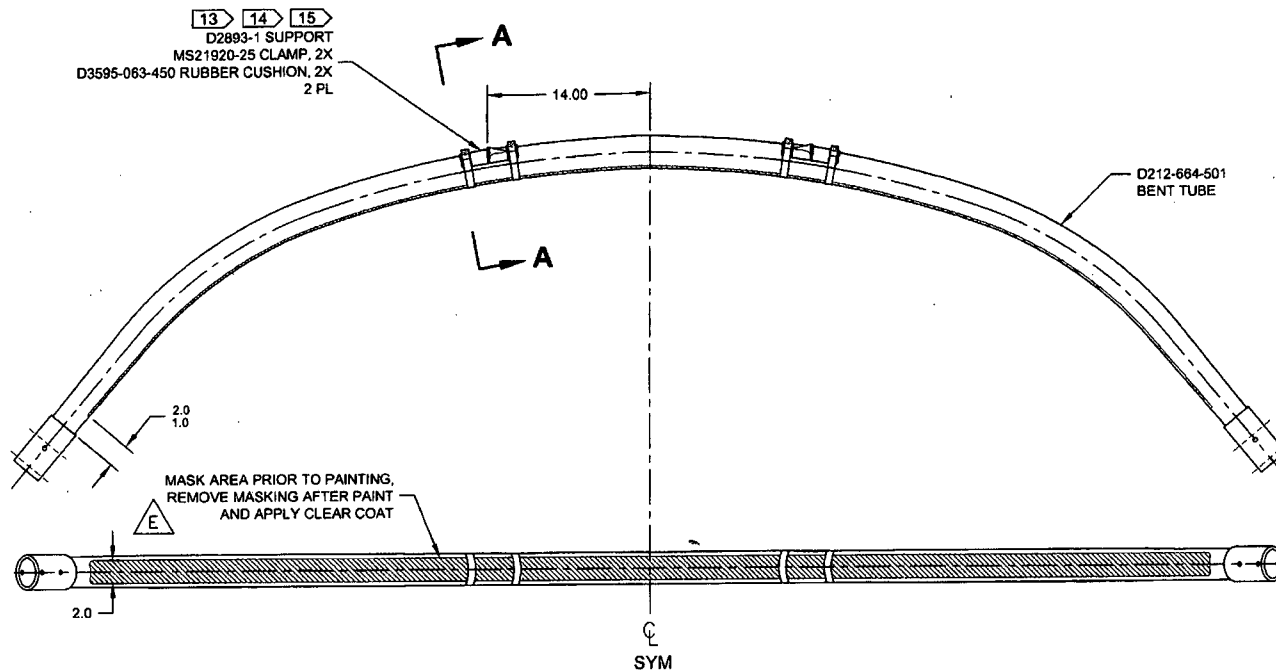


**SECTION A-A**  
SCALE 4X


**D212-664-141/-141F**  
**ASSEMBLY DETAIL**

**RELEASED**  
2014-05-26

DESIGN	Q	<b>DART AEROSPACE LTD</b>	
DRAWN	Q	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	Q	D212-664-141	SHEET 2 OF 5
APPROVED	Q	TITLE	SCALE
DE APPR.	Q	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	<small>COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

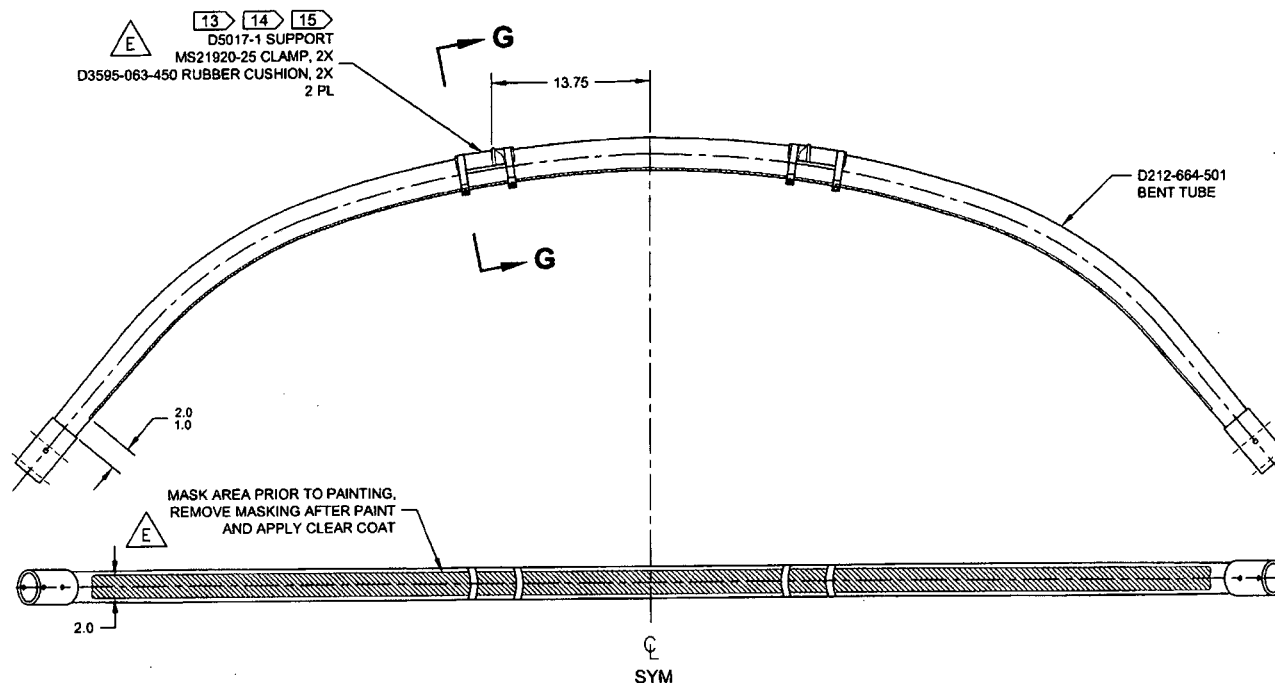



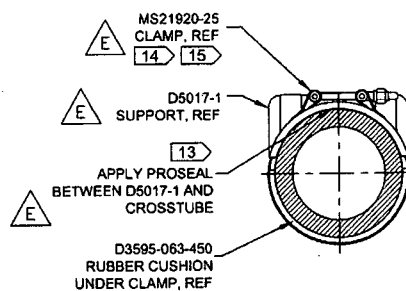


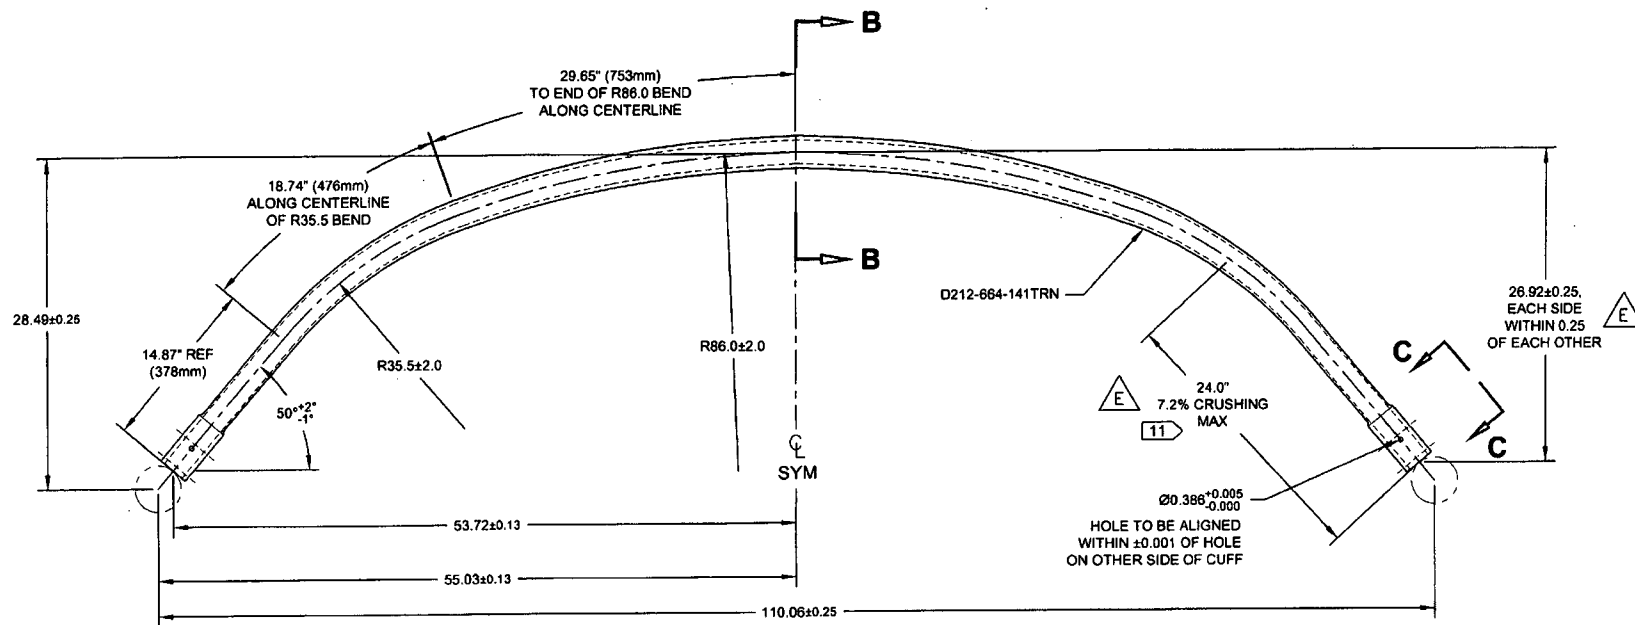
**D212-664-141B**  
**ASSEMBLY DETAIL**




**SECTION G-G**  
**SCALE 4X**

**RELEASED**  
2014-05-26


DESIGN		<b>DART AEROSPACE LTD</b>	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED	DL	DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 3 OF 5
APPROVED		TITLE	SCALE
DE APPR.		XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			



**D212-664-501**  
**BENDING AND DRILLING DETAIL** 11

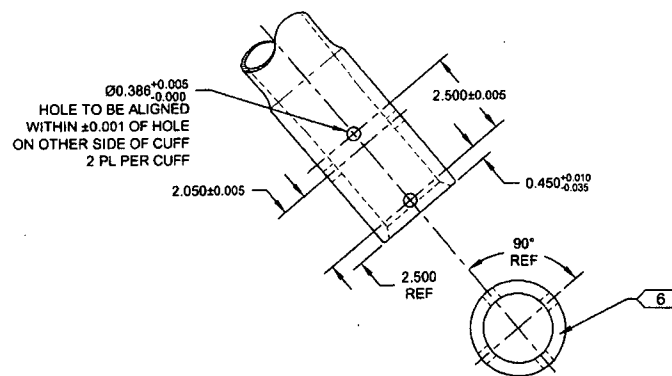


**VIEW C-C: CUFF DETAIL**  
SCALE 3X

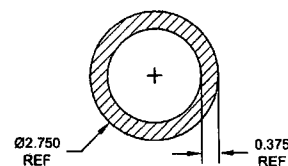

**SECTION B-B**  
SCALE 4X

**RELEASED**  
2014-05-26

DESIGN	92	<b>DART AEROSPACE LTD</b>	
DRAWN	92	HAWKESBURY, ONTARIO, CANADA	
CHECKED	92	DRAWING NO.	REV. E
MFG. APPR.	92	D212-664-141	SHEET 4 OF 5
APPROVED	92	TITLE	SCALE
DE APPR.	92	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
		THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

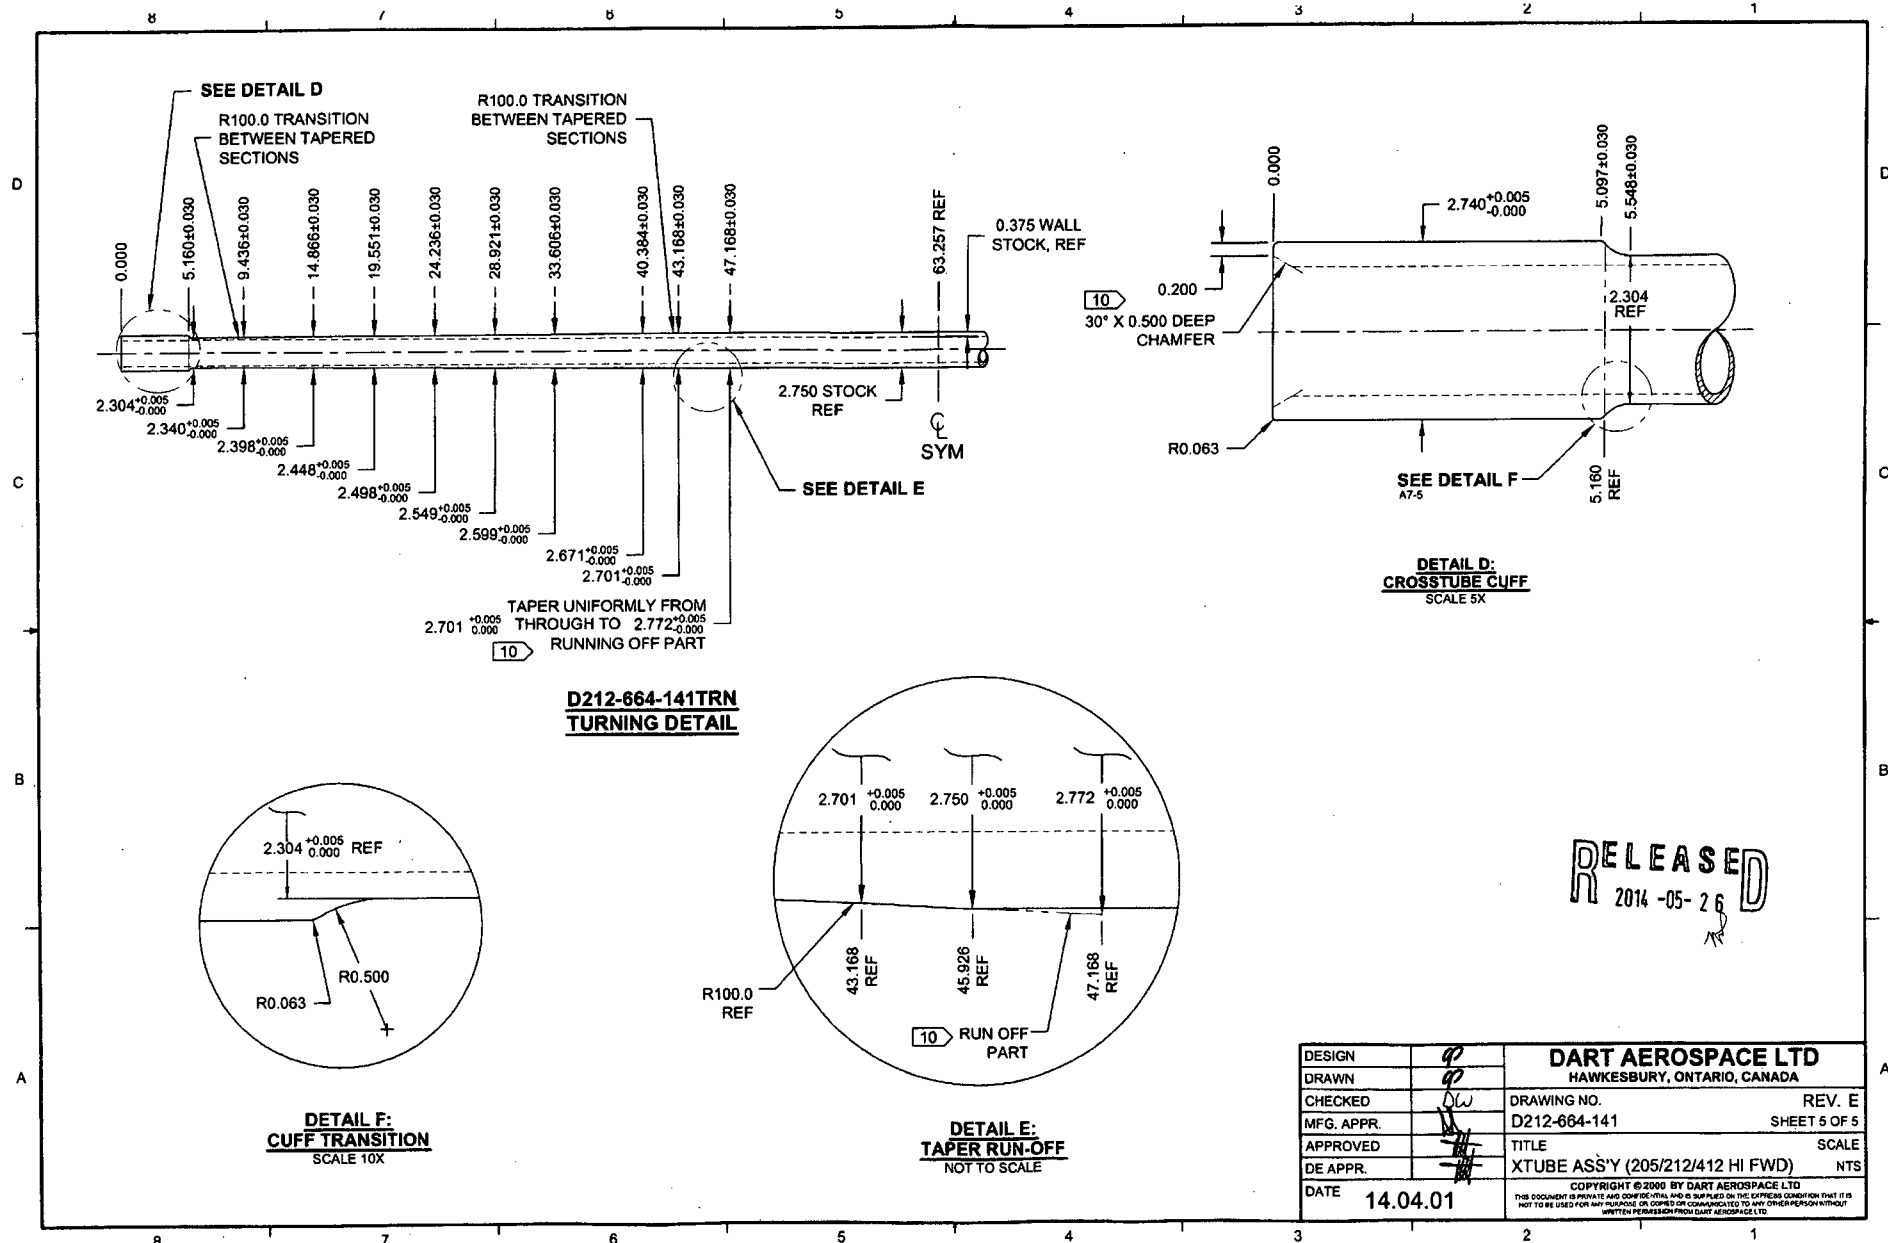



## D212-664-101

### BATCH NUMBER:

**SET UP** - 2.75 Rollers x 3 w/1.6" shims  
2.875" in buggy A

TANGENT LINES from cuff @ 33.6, **36.46 RED**, then Centerline is @ 63.25

### MIDDLE BENDS

**Start bending @ 33.6 line** with longest part of tube on small table. Appr is **2600 on both Y&W**.

Use program 212fMauto.

**MATCH MIDDLE BEND TO OUTLINE ON REFERENCE BOARD** slightly below line is acceptable. (no more than 0.030")

**DO NOT** underbend middle or you will have issues finishing tube

use middle fix program if not bent enough ..(mfix, mfix2)

If middle still is underbent modify 24" section of middle fix program and re-run.

### SIDE BENDS

**Start bending @ 36.46 line**. with longest part of tube on large table **1500 appr on Y and 3735 on W**. W stays @ this appr on all programs. Run 1-2-3 without stopping, then check.

If tube isn't bent enough run 3aaa and up as required to finish. .checking between each program..

... **2000 for Y and 3735 for W**..

### **Notes:**

- underbent middle by approx 0.060". was **UNABLE** to reach nominal dimensions. scrapped tube after rebending middle to achieve nominal dimensions. "middle fix after sides are bent" was over effective, it runs from centre line out. therefore. **DO NOT** underbend middles, and use caution if using "middle fix after sides are bent" program. jw 12/6/1

14/02/26.. Bent 4 tubes, (Ran 212fMauto, Mfix, Mfix2) middle finished even to outline on new board.

Side bends were prog.(1,2,3,3c..CHECK) ran 5,6 and up checking between each until finished (prog. 4 was skipped on all 4 tubes) ..

### Passes:

<del>MA</del>	
<del>MA</del>	
<del>MA</del>	
L	R
1	1
2	2
3	3
3c	3c
check	check
4	4
5	5





**skyservice**  
Air travel. Evolved.

# NDT Work Order

Sky Service F.B.O. Inc.

DOT APP 53-89 / EASA 145.7142 / BDA AMO 385

WO #: YYZ

70277

Customer: DART AEROSPACE Dept: NDT YYZ

Reference: 25590

Make:

Model:

Reg:

A/C S/N:

TSN:

CSN:

TSO:

Tail#:

Task: ☒ Scheduled ☐ Unscheduled ☐ A.O.G. ☒ P.T. ☐ M.T. ☒ E.T. ☐ U.T. ☐ R.T.

## Work Required:

CARRY OUT NDT ON THE FOLLOWING FWD CROSSTUBES

ITEM ID D212-664-101 (9 TOTAL)

W.O. ID 123286

W.O. ID 123284

W.O. ID 123291

W.O. ID 123287

W.O. ID 123288

W.O. ID 123289

W.O. ID 123292

W.O. ID 123290

DAS  
38  
9-89

W.O. ID 123285

## Action Taken:

Date:

Initial/Stamp:

LIQUID PENETRANT AND EDDY CURRENT

INSPECTIONS CARRIED OUT ON

02 SEPT 2014

NINE (9) WORK ORDER FWD CROSSTUBES

LISTED ABOVE. IAW ASTM E1417-M13

NO CRACKS FOUND

BLACK LIGHT = T-209 90N

PENETRANT = ARDAX 9TO P2SE BATCH 02312131

EDDY CURRENT = NORTEL 500S S/N T-20656 CAL DUE 30 JAN 2015

I certified that the maintenance described above has been performed with the applicable standard of airworthiness.

Signature:

GARY SMITH

ACA/SCA Stamp



Date:

02 SEPT  
2014

Name: